

642:512

Dart Aerospace Ltd.

Date: Tuesday, 12/05/2009 3:07:42 PM
 User: Julie Dawson

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	FLOAT SKIDTUBE ASSEMBLY
Job Number :	47926A		
Estimate Number :	10309		
P.O. Number :		Part Number :	D206642541
This Issue :	12/05/2009	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D3274 REV D
First Issue :	11	Project Number :	N/A
Previous Run :	47925A	Drawing Revision :	D
	Type :	Material :	
	SKIDTUBES	Due Date :	12/06/2009
Written By :		Qty:	1 Um: Each
Checked & Approved By :	<u>27009.05.12</u>		
Comment :	Est Rev:B 05.09.23 Revised per D206-642 Rev. J KJ/JLM Est Rev:C 07-02-23 Added SS Wearplates & Gaskets JLM Est Rev:D 07-12-06 replace NAS1515H3L to D3672-1 DD Est Rev:E 08-04-17 as per PAR 08-015 DD verified by:EC Est Rev:F 08-06-02 add comment DD verified by:EC Est Rev:G 08-10-09 revise details DD verified by:EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-541 CHG003

N/A

2.0	D26001190	Extrusion Round 3" 206
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-1-190 3" OD Tube 31032

27 09.05.13

3.0	D32851	Cap
-----	--------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3285-1 Fwd Cap

347635 BE 09.05.13

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1- Bend FWD end of tube using bend prog D3274 FWD dwg D3274, cut fwd end of tube with saw table setup 27 09.05.13

2- remove fwd indexing ridge as per dwg D3274. Prepare for welding

27 09.05.13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

3- weld fwd cap as per dwg D3274 and QSI004

AR Aluminum Rod Batch:

m/09213 / m111679 DE 09/05/13

4- grind fwd cap weld on top surface only

DE 09/05/13

5- Cut AFT end of tube at 170.9" as per dwg D3274 and deburr end.

6-Drill Aft cap pilot hole using DT8025

7 -Cleco DT8025 in position and install pilot hole drill Jig DT8742A,B,C,D. Drill 3/16" pilot holes as per Dwg D3274

8 -Remove inner indexing ridge on aft end of skidtube as per Dwg D3274 scribe batch #

9 -Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

*Pm's
09-05-14*

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

ET 09-05-14

6.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 09/05/14

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/14

8.0

D3282041

Float Web (206L/407)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

B 47593

D

K 9-5-14

9.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Ø0.313" and 0.375" crossbolt spacer holes using DT8743 as per Dwg D3274

ET 09-05-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

2-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

KT 09-05-14

3-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

M111081

Sikaflex expire date:

12-1-20

Start: 9-5-14

Time: 1:25

Finish: 7:15/19

Time: 8:00AM

(Adhere for 12 hours)

M 9-5-14

10.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8 09/05/19

11.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend AFT end of tube using bend prog. D3274 AFT as per dwg D3274. Install drop pins in crossbolt spacer holes to maintain web position.

KT 09-05-14

2- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2
OPEN HOLES TO .297" . Deburr

M 9-5-14

3-DRILL TOE PIN HOLE .640" DIA AS PER DWG USING DT8935 FWD END OF TUBE
DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

4- Countersink crossbolt spacer holes as per Dwg D3274

5- prepare for welding

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

h = 2.9"
L = 4.8"

8 09/05/19

13.0

D2649

Cross Bolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

12 D2649

Crossbolt spacer

45317

14

M 9-5-14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

D32751

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D3275-1 Crossbolt spacer

047624 (12)

19-5-19

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod M109213 BE 09/06/02

3-Grind cross bolt welds flush as per Dwg D3274.

4-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr.

PM 09-06-04

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09/06/04

17.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

09/06/04

18.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FD 09/06/04

19.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M 111 472

START TIME:

10:20

OVEN TEMPERATURE:

320°

FINISH TIME:

11:50

BR 09-06-4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

UMP 09/06/09

21.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D3415-041 Nut Plate B 33842

UMP 09/06/09

22.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 CCR264SS3-3 Rivet M111548

UMP 09/06/09

23.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 CR3212-4-03 Rivet M15984

UMP 09/06/09

24.0

ALS71032130

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Insert

* Batch: M110511

UMP 09/06/09

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3 M104251

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a

UMP 09/06/09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291

M1155+

Sikaflex expire date:

10/20

UMD 09/06/09

26.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Nut Plate & Inserts

S09/06/09 @

27.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total: 80.0000 Each(s)

BOLT

Batch:

M11668

UMD 09/06/09

28.0

D353515

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B47521

UMD 09/06/09

29.0

D353523

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B46648

UMD 09/06/09

30.0

D353535

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B39233

UMD 09/06/09

31.0

D353539

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch:

B44645

UMD 09/06/09

32.0

D353615

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch:

B47315

UMD 09/06/09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: .Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

33.0	D353623	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B46884

UMD 09/06/09

34.0	D353635	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: 46885

UMD 09/06/09

35.0	D353639	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B44648

UMD 09/06/09

36.0	D35371	Wearpad
------	--------	---------



Comment: Qty.: 9.0000 Each(s)/Unit Total: 9.0000 Each(s)

WEARPAD

Batch: B47715

UMD 09/06/09

37.0	D35373	Wearpad
------	--------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARPAD

Batch: B35697

UMD 09/06/09

38.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 80.0000 Each(s)/Unit Total: 80.0000 Each(s)

Pick:

Qty Part Number

Description Batch

80 AN960C10L

Washer

M11808

UMD 09/06/09

39.0	D36721	Phenolic Washer
------	--------	-----------------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

batch: B42329

UMD 09/06/09

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1 Ring B33949

UMD 09/06/09

41.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN4C5A Bolt M110552

UMD 09/06/09

42.0

AN960C416

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960C416 Washer M100993

UMD 09/06/09

43.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap B46387

UMD 09/06/09

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

A/R Sikaflex-291 M111557

Sikaflex expire date: 10/06

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R LPS-3 Batch: _____

(X1)

UMD 09/06/09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 12/05/2009 3:07:42 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 47926A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

A/R Sikaflex-291

Sikaflex expire date:

M114557
10/01

UMP 09/06/09

45.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09/06/09

46.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

CO

Identify and stock

Location:

RR 47926

9/6/11

SL

47.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/06/12

Job Completion



U 09/06/12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN CP	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D3274	REV. D SHEET 1 OF 4
DATE 06.12.19		TITLE SKIDTUBE ASSEMBLY	SCALE NTS
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	
D	06.12.19	NEW INSERTS, SS WEARSHOE + GASKET	

RELEASED

07.02.12 **[Signature]**

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER


GENERAL NOTES:

- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- ALL HOLES DRILLED ON CENTERLINES.
- BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
- WELDING TO BE DONE PER DART QSI 004.
- FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
- DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL 130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
- SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.


UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 47920

Copyright © 2004 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

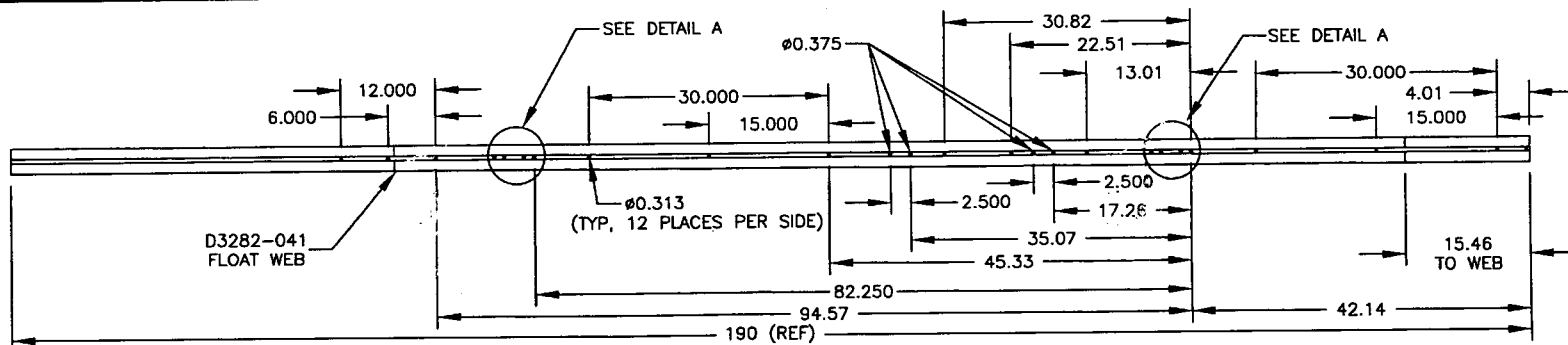

D3274-041 DRILLING/ASSEMBLY DETAIL

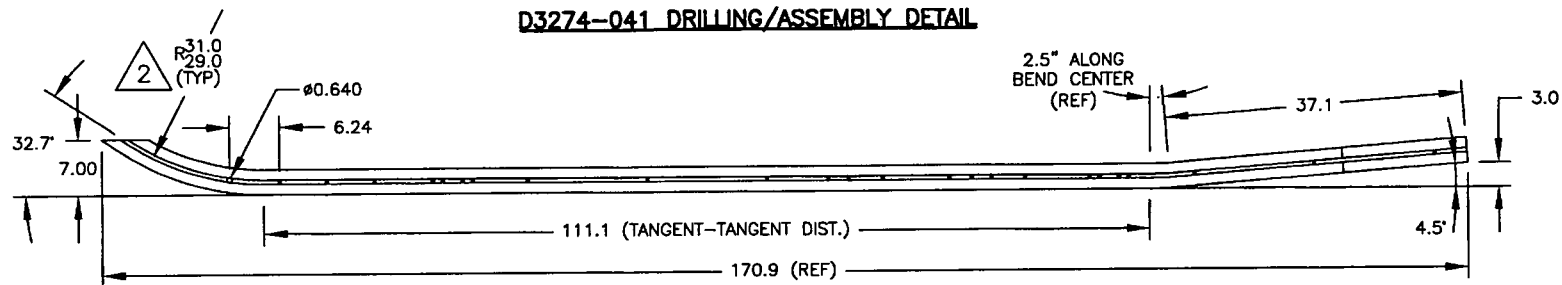

D3274-041 BEND/DRILLING DETAIL

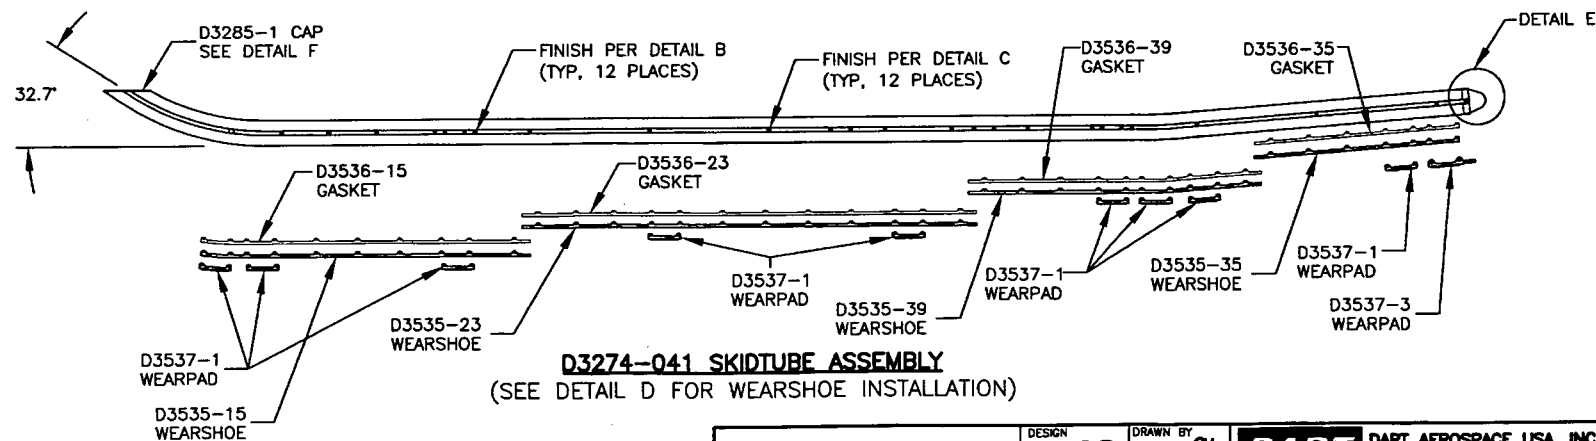

D3274-041 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 479301A


RELEASED

07.02.12


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.


DESIGN CP	DRAWN BY AH	DART DART AEROSPACE USA, INC. PORT HADLOCK, OH	
CHECKED #	APPROVED #	DRAWING NO. D3274	REV. D SHEET 2 OF 4
DATE 06.12.19	TITLE SKIDTUBE ASSEMBLY		SCALE 1:15

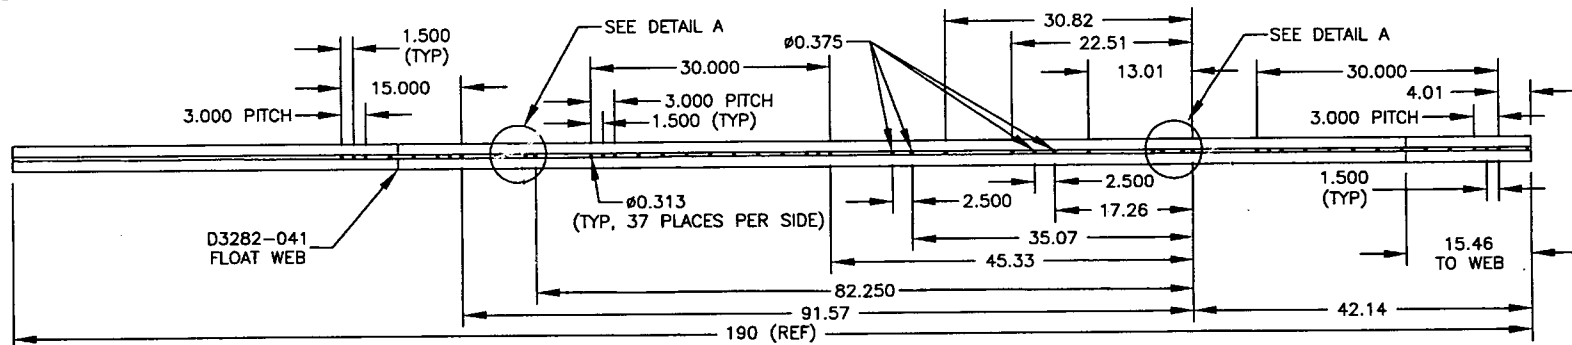

D3274-043 DRILLING/ASSEMBLY DETAIL

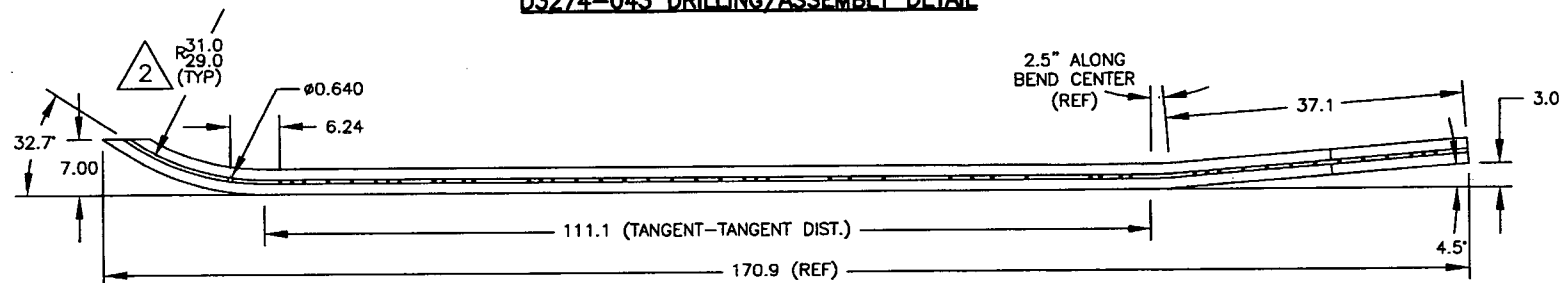

D3274-043 BEND/DRILLING DETAIL

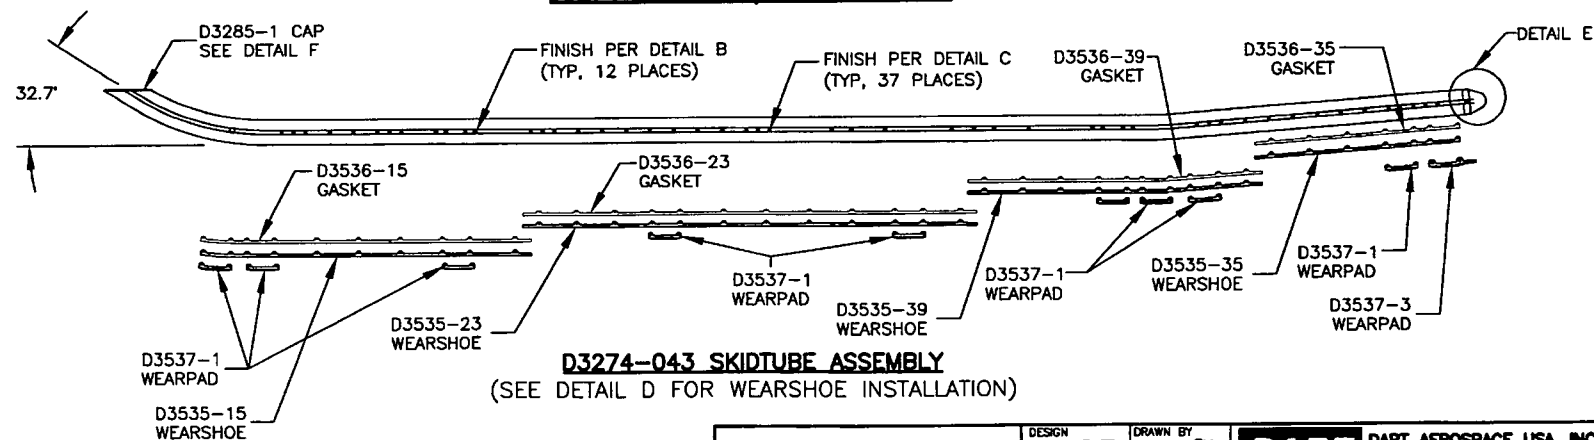

D3274-043 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 4792007

RELEASED


07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN CP	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	
CHECKED H	APPROVED H	DRAWING NO. D3274	REV. D SHEET 3 OF 4
DATE 06.12.19	TITLE SKIDTUBE ASSEMBLY		SCALE 1:15

DETAIL A: DRILL DETAIL

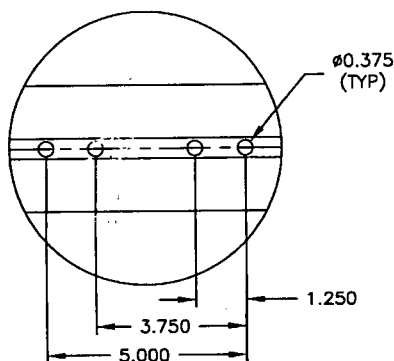


DETAIL B FOR 0.375 HOLES ONLY

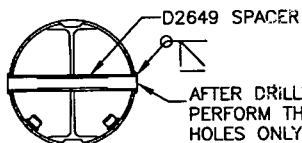


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR 0.375
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
2. INSERT D2649 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE TO 0.313x0.75 DEEP

DETAIL C FOR 0.313 HOLES ONLY

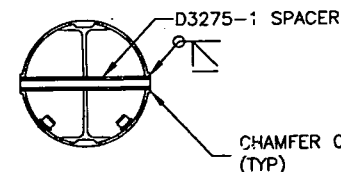

DETAIL D

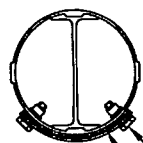

ALS7-1032-130 INSERT (1)
AN3C4A BOLT (1)
AN960C10L WASHER (1)
(78 PLACES)


GASKET/WEARSHOE/WEARPAD (REF)

DETAIL E

AN3C4A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(2 PLACES)
INSTALL WITH SIKAFLEX-241/-291

D2646 CAP


SEAL WITH
SIKAFLEX-241/291
ADHESIVE

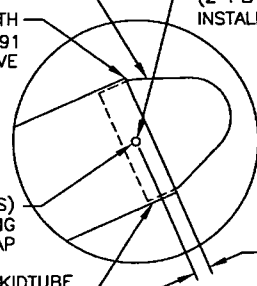

0.208 (2 PLACES)
DRILL PRIOR TO INSTALLING
D2646 CAP

BORE OUT END OF SKIDTUBE
TO 0.75 DEPTH AND 0.070 WALL

DETAIL F: END FINISHING DETAIL

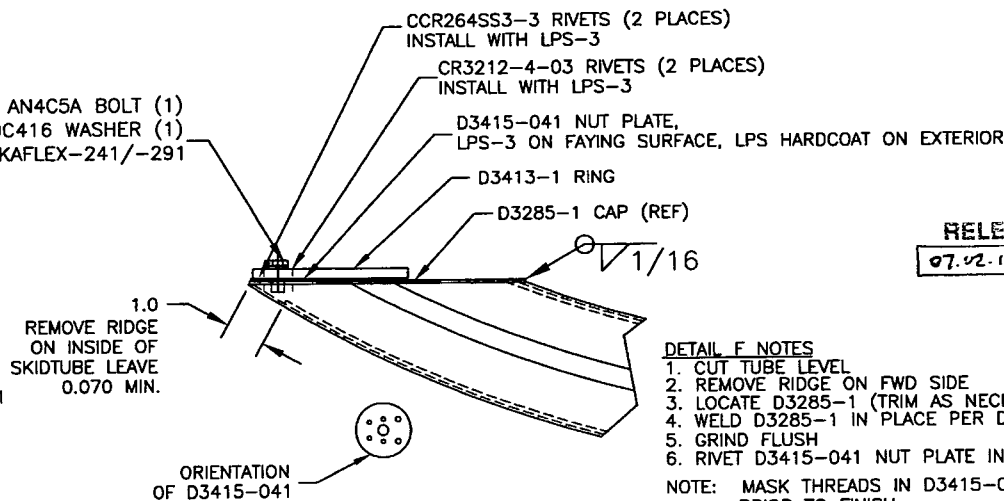

DETAIL F NOTES
1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D3285-1 (TRIM AS NECESSARY)
4. WELD D3285-1 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN PLACE
NOTE: MASK THREADS IN D3415-041
PRIOR TO FINISH

RELEASED
07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN CP	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, OH	
CHECKED #	APPROVED #	DRAWING NO. D3274		REV. D SHEET 4 OF 4	
DATE 06.12.19		TITLE SKIDTUBE ASSEMBLY		SCALE 1:3	

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

NO 479207
VARY ADAPD
WITHOUT NOTICE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
ENGINEERING
RETURN TO
SHIP COPY
REPAIR TO

NO. 198

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 47288A
Part number: D206 642 545
Description: 206 skid tube
Welding Process: Tig ☒ Mig ☐
Base material: Aluminum
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual:	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>
Penetration:	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>

UNACCEPTABLE

Cracks:	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>
Undercut:	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>
Pin holes:	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>
Overlap (cold lap)	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>
Porosity (surface):	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>
Coloration:	pass <input checked="" type="checkbox"/>	fail <input type="checkbox"/>

Qualifier P. D. [Signature] Date of Test Coupon 09.04.27
Welder Barclay Elliott Date of Test Coupon 09.04.27

The above named individual is qualified in accordance with AWS D17.1.2001 to weld